



3855 North Ocoee Street, Suite 200  
Cleveland, TN 37312

SENT BY FEDERAL EXPRESS

January 11, 2013

Mr. Patrick Bowe  
Director  
Remediation Division  
Bureau of Water Protection and Land Reuse  
State of Connecticut Department of Energy and Environmental Protection  
79 Elm Street  
Hartford, CT 06106

Re: Property-Specific Remedial Action Report  
Newhall Street Neighborhood  
16 Marlboro Street, Block Q  
Hamden, Connecticut 06517

Dear Mr. Bowe:

Enclosed please find the Property-Specific Remedial Action Report (RAR) prepared for the property located at 16 Marlboro Street in Hamden, Connecticut. The Property-Specific RAR summarizes the remediation and restoration activities conducted at the property as required by Consent Order No. SRD-128. Remediation and restoration of this property are complete and were implemented in compliance with the Remedy Selection Plan and the Generic Remedial Action Plan (RAP) that were prepared for and approved by the Connecticut Department of Energy and Environmental Protection (DEEP).

Section 2.0 of the enclosed report documents property-specific construction activities that were required due to the extent of fill encountered excavation. Please note that all field activities were completed pursuant to the approved Generic RAP and/or with DEEP oversight and approval. Olin hereby submits this Property-Specific RAR for DEEP approval. As noted below and as required by the Remedy Selection Plan, a copy of the enclosed report has also been provided to the property owner.

Please contact me at (800) 295-6141 if you have any questions regarding this matter.

Sincerely,  
OLIN CORPORATION

A handwritten signature in black ink, appearing to read "David M. Share".

David M. Share  
Director, Environmental Remediation

cc: Troy McNulty – 16 Marlboro Street, Hamden, Connecticut 06517  
Curt Richards – Olin  
Carrie Hunt – Olin  
Nelson Walter – AMEC  
Robert Bell – DEEP  
Ray Frigon – DEEP  
Richard Pearce – Newhall Street Neighborhood Community Liaison  
Robert Labulis – Town of Hamden Building Department

**PROPERTY-SPECIFIC REMEDIAL ACTION REPORT  
16 MARLBORO STREET**

**NON-PUBLIC PROPERTIES  
NEWHALL STREET NEIGHBORHOOD  
HAMDEN, CONNECTICUT**

*Prepared for:*



**Olin Corporation**  
3855 North Ocoee Street, Suite 200  
Cleveland, TN 37312

*Prepared by:*



**AMEC Environment & Infrastructure, Inc.**  
1090 Elm Street, Suite 201  
Rocky Hill, Connecticut 06067

**January 11, 2013**

**AMEC Project Number: 6107120004.165**

**PROPERTY-SPECIFIC REMEDIAL ACTION REPORT  
16 MARLBORO STREET**

**NON-PUBLIC PROPERTIES  
NEWHALL STREET NEIGHBORHOOD  
HAMDEN, CONNECTICUT**

*Prepared For:*



**Olin Corporation**  
3855 North Ocoee Street, Suite 200  
Cleveland, TN 37312

*Prepared By:*



**AMEC Environment & Infrastructure, Inc.**  
1090 Elm Street, Suite 201  
Rocky Hill, Connecticut 06067

January 11, 2013

**AMEC Project Number: 6107120004/165**

A handwritten signature in black ink that reads "Nelson Walter".

---

Nelson Walter, P.E.  
Project Manager

A handwritten signature in black ink that reads "J. Rod Pendleton".

---

Rod Pendleton, P.G  
Principal Scientist

## DOCUMENT CERTIFICATION

I have personally examined and am familiar with the information submitted in this document and all attachments thereto, and I certify, based on reasonable investigation, including my inquiry of those individuals responsible for obtaining the information, that the submitted information is true, accurate and complete to the best of my knowledge and belief. I understand that any false statement made in the submitted information is punishable as a criminal offense under §53a-157b of the Connecticut General Statutes and any other applicable law.

David M. Share, Director, Environmental Remediation

  
\_\_\_\_\_  
Chief Executive Officer (or duly authorized representative)  
Olin Corporation

## DOCUMENT CERTIFICATION

I have personally examined and am familiar with the information submitted in this document and all attachments thereto, and I certify, based on reasonable investigation, including my inquiry of those individuals responsible for obtaining the information, that the submitted information is true, accurate and complete to the best of my knowledge and belief. I understand that any false statement made in the submitted information is punishable as a criminal offense under §53a-157b of the Connecticut General Statutes and any other applicable law.

Nelson Walter, Project Manager



---

AMEC Environment & Infrastructure, Inc.

**TABLE OF CONTENTS**

---

1.0	INTRODUCTION .....	1-1
1.1	Regulatory Status.....	1-1
1.2	Description of Remedy Process .....	1-1
2.0	PROPERTY-SPECIFIC CONSTRUCTION ACTIVITIES.....	2-1
3.0	REFERENCES .....	3-1

**FIGURES**

---

Figure 2-1 Post-Construction Conditions

**TABLES**

---

Table 2-1 Excavation Confirmation XRF Sampling Results

**ATTACHMENTS**

---

A Photographs

## ACRONYMS AND ABBREVIATION

---

AMEC	AMEC Environment & Infrastructure, Inc.
bgs	below ground surface
DEEP	Connecticut Department of Energy and Environmental Protection
mg/kg	milligrams per kilogram
NPP	Non-Public Properties
Olin	Olin Corporation
RAP	Remedial Action Plan
RAR	Remedial Action Report
RSP	Remedy Selection Plan
XRF	X-ray fluorescence

## 1.0 INTRODUCTION

This Property-Specific Remedial Action Report (RAR) was prepared by AMEC Environment & Infrastructure, Inc. (AMEC) on behalf of Olin Corporation (Olin) for the property located at 16 Marlboro Street in Hamden, Connecticut. This Property-Specific RAR was prepared based on information obtained during remediation activities conducted at the property during the 2012 construction season. This document provides information about the remediation activities completed for the property, which are required by Consent Order SRD-128 entered into by Olin, the Town of Hamden, the Regional Water Authority, the State Board of Education, and the State of Connecticut Department of Energy and Environmental Protection (DEEP). The Consent Order requires Olin to excavate and remove fill material up to 4 feet below ground surface (bgs) from approximately 230 residential properties within the Consent Order boundary.

Section 1 of this report provides a summary of site history and a general description of the remedy process for the Newhall Street Neighborhood. Section 2 of this report describes the construction activities conducted at 16 Marlboro Street.

### 1.1 Regulatory Status

In April 2003, the DEEP issued a Consent Order to Olin, the Town of Hamden, South Central Connecticut Regional Water Authority, and the State Board of Education (DEEP, 2003). The Consent Order requires Olin to investigate and remediate the Non-Public Properties (NPP) within the Consent Order boundary of the Newhall Street Neighborhood.

### 1.2 Description of Remedy Process

In October 2007, a Final Remedy Selection Plan (RSP) was approved and issued by the Commissioner of the DEEP (DEEP, 2007). The remedy for the NPP within the Consent Order boundary is summarized below:

- Excavation of fill within the top 4 feet;
- Disposition of excavated material at authorized off-site facilities;
- Backfilling of excavated areas with clean soil; and
- Restoration of existing features including landscaping, patios, fencing, driveways, etc. that are disturbed during construction activities.

The Final Design - Generic Remedial Action Plan (RAP) (AMEC, 2008), was approved by the DEEP and serves as the basis for remedial action activities within the NPP. The Final Design - Generic RAP details remedial construction activities including excavation of fill to a depth of up to four feet, backfilling excavations, disposition of fill and debris, and restoration of disturbed areas. Detailed plans and specifications regarding the remediation are contained in the Generic RAP and other project plans which have been approved by the DEEP. The Final Design - Generic



RAP and other plans are available at the Town of Hamden Miller Public Library located at 290 Dixwell Avenue, and on the DEEP website at: <http://www.newhallinfo.org>.

Prior to implementing the approved remedial solution, a Property-Specific RAP was prepared for the owner of each property where it was known that waste fill was present. The Property-Specific RAPs were submitted to the DEEP for approval. The purpose of the Property-Specific RAP was to provide the homeowner with information regarding the planned construction activities, temporary relocation requirements (if necessary), access provisions, an estimated time table to complete the planned work, and a description of plans to restore the property to existing conditions. Because, prior to excavation activities, it was not known that there was waste fill present on this property, a Property-Specific RAP was not prepared for 16 Marlboro Street.

## 2.0 PROPERTY-SPECIFIC CONSTRUCTION ACTIVITIES

During the 2012 construction season, Olin completed the excavation, backfill, and restoration of the property in accordance with the Final Design - Generic RAP. Figure 2-1 shows the areas where excavation occurred on the property and the locations of excavation confirmation samples. Excavation confirmation samples were collected in accordance with Section 3.2.3 - Confirmatory Sampling of the Final Design - Generic RAP, including adherence to the sampling frequency requirements. X-ray fluorescence (XRF) excavation confirmation sampling results are presented in Table 2-1.

As indicated in Table 2-1, all confirmation sampling results indicate total lead concentrations less than the criteria of 400 mg/kg approved by DEEP in the Final Design - Generic RAP.

Below are details regarding the marker barrier installed following excavation activities:


- In some locations on the property, fill material was present at depths greater than 4 feet below ground surface (bgs). This fill material was left in place, covered by an orange geotextile fabric, and backfilled with clean soil in accordance with the Final Design - Generic RAP. Figure 2-1 shows the approximate area of geotextile fabric identifying the presence of fill at a depth greater than 4 feet bgs.
- In some locations it was necessary to leave fill material in place at depths less than 4 feet bgs in order to avoid jeopardizing the integrity of a structure or feature that was to be left in place. This fill material was left in place, covered by an orange geotextile fabric and/or concrete, and backfilled with clean soil in accordance with the Final Design - Generic RAP. Figure 2-1 shows the approximate area of geotextile fabric/concrete identifying the presence of fill at a depth less than 4 feet bgs.

Photographs of construction activities and the restored property are presented in Attachment A.

### 3.0 REFERENCES

- DEEP, 2003. Order No. SRD-128, State Of Connecticut vs. Town Of Hamden, South Central Connecticut Regional Water Authority, State Board Of Education, and Olin Corporation. State of Connecticut Department of Energy and Environmental Protection, April 16, 2003.
- DEEP, 2007. Remedy Selection Plan, Newhall Street, Neighborhood Remediation Project. State of Connecticut Department of Energy and Environmental Protection, October 2007
- AMEC, 2008. Final Design - Generic Remedial Action Plan, Non-Public Properties, Newhall Street Neighborhood, Hamden, Connecticut. AMEC Environment & Infrastructure, Inc., August 19, 2008.

## FIGURES

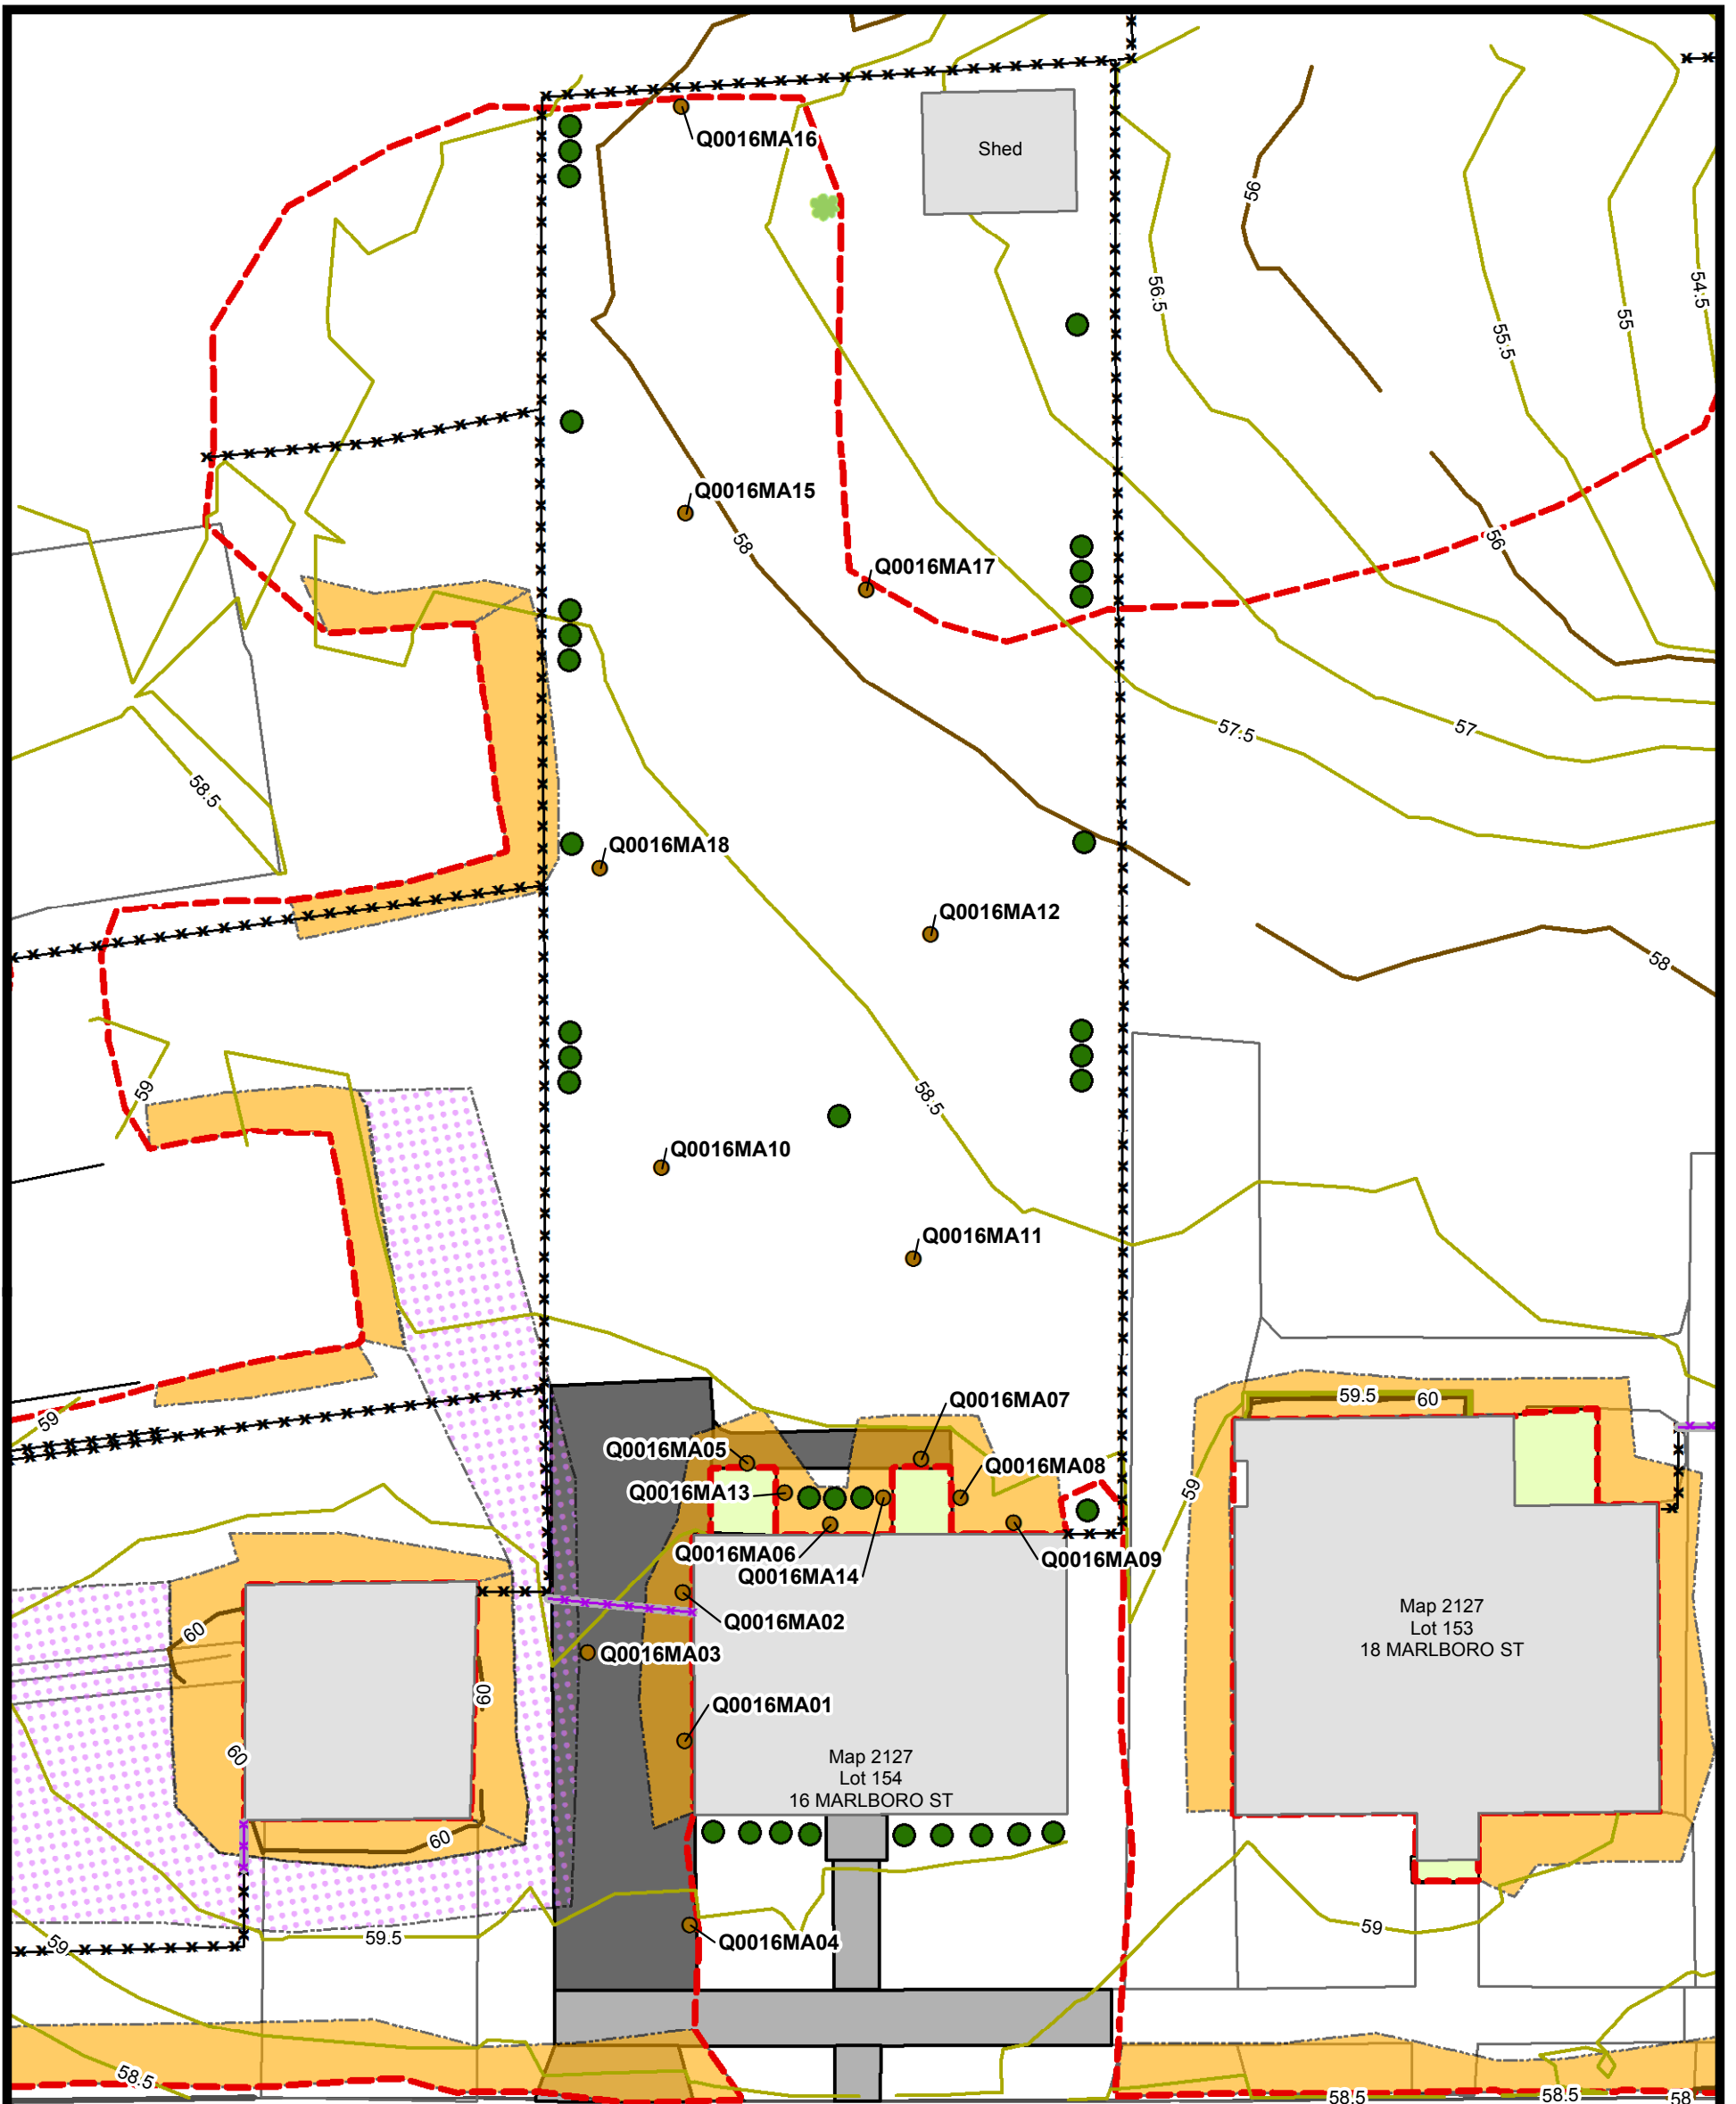


**Marlboro Street**

**Legend**

- |  |   |                              |                               |
|--|---|------------------------------|-------------------------------|
| Approximate Extent of Orange Marker Barrier Covering Fill > 4 ft bgs Remaining on Property | Excavation Confirmation Sample            | New Tree                     | Stairs/Porch                  |
| Approximate Extent of Marker Barrier Covering Fill < 4 ft bgs Remaining on Property        | Limits of Excavation                      | New Shrub                    | New Fence                     |
| Final Elevation Contour (2-ft interval)  | Final Elevation Contour (0.5-ft interval) | New Fence Gate               | New Asphalt Driveway/Sidewalk |
|  |   | New Concrete Sidewalk/Stairs |                               |

Note: All grass areas disturbed by excavation were restored with sod and/or seed/mulch.



Prepared/Date: BRP 12/11/12  
Checked/Date: DRP 12/11/12

## **TABLES**

**TABLE 2-1  
EXCAVATION CONFIRMATION XRF SAMPLING RESULTS**

**16 MARLBORO STREET  
NEWHALL STREET NEIGHBORHOOD  
HAMDEN, CONNECTICUT**

Location ID	Location Type	Field Sample ID	Sample Date	Top Depth (ft,bgs)	Bottom Depth (ft,bgs)	Parameter	Result	Final Qualifier	Unit of Measure
Q0016MA01EX	PES	Q0016MA-SON0103EX	24-Jul-12	3	3	Lead	69		MG/KG
Q0016MA02EX	PES	Q0016MA-SON0203EX	24-Jul-12	3	3	Lead	61		MG/KG
Q0016MA03EX	PEB	Q0016MA-SON0303EX	25-Jul-12	3	3	Lead	78		MG/KG
Q0016MA04EX	PES	Q0016MA-SON0403EX	25-Jul-12	3	3	Lead	50	U	MG/KG
Q0016MA05EX	PES	Q0016MA-SON0502EX	25-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA06EX	PES	Q0016MA-SON0602EX	25-Jul-12	2	2	Lead	61		MG/KG
Q0016MA07EX	PES	Q0016MA-SON0702EX	25-Jul-12	2	2	Lead	95		MG/KG
Q0016MA08EX	PES	Q0016MA-SON0802EX	25-Jul-12	2	2	Lead	78		MG/KG
Q0016MA09EX	PES	Q0016MA-SON0902EX	25-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA10EX	PEB	Q0016MA-SON1002EX	26-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA11EX	PEB	Q0016MA-SON1103EX	25-Jul-12	3	3	Lead	50	U	MG/KG
Q0016MA12EX	PES	Q0016MA-SON1202EX	26-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA13EX	PES	Q0016MA-SON1302EX	26-Jul-12	2	2	Lead	125		MG/KG
Q0016MA14EX	PES	Q0016MA-SON1402EX	26-Jul-12	2	2	Lead	126		MG/KG
Q0016MA15EX	PEB	Q0016MA-SON1502EX	27-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA16EX	PES	Q0016MA-SON1602EX	31-Jul-12	2	2	Lead	89		MG/KG
Q0016MA17EX	PES	Q0016MA-SON1702EX	31-Jul-12	2	2	Lead	50	U	MG/KG
Q0016MA18EX	PEB	Q0016MA-SON1803EX	31-Jul-12	3	3	Lead	58		MG/KG

Notes: bgs - below ground surface  
ft - feet  
KG - kilograms  
MG - milligrams  
PEB - sample from bottom of excavation  
PES - sample from perimeter of excavation  
U - not detected at a concentration above the reporting limit  
XRF - x-ray fluorescence

**ATTACHMENT A  
PHOTOGRAPHS**





**View looking southwest at excavated driveway area.**



**View looking northwest at excavated side yard following placement of marker barrier.**



**View looking north at excavated back yard.**



**View looking southwest at restored front yard.**



**View looking north at restored back yard.**



**View looking south at restored back yard.**